


**Cable to Ground Rod**

**GO**

**Mold Information:**

- Molds listed are for stranded cable. For solid conductor, add suffix "S" after conductor number. i.e. 4S = 4 AWG solid conductor.
  - Molds listed are for tapered ground rods. For threaded sectional rods, add suffix "S" after the ground rod number. i.e. 5S8 = 5/8" sectional ground rod.
  - Molds with Price Key "**L**" and "**M**" SOLD WITH HANDLES.
  - Handles for "**L**" and "**M**" Price Key Molds DO NOT INCLUDE Flint Igniters.
  - If Handles not required, add suffix "-X" after the Mold Part No.
  - Price Key is the **Bold Letter** in the Mold Part No.
  - For mold Wear Plates, add suffix "WP" to the end of the Mold Part No.
- See page 324 for details.

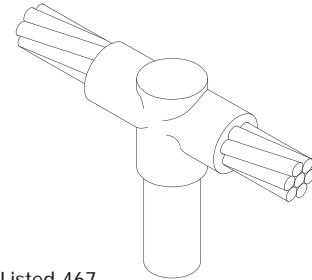

**GO**

(Horizontal Thru Cable to Top of Ground Rod)

**Required Tools & Accessories:**

- MH1 - Handle for "**B**" Price Key Molds
- MH2 - Handle for "**C**" Price Key Molds
- FLTIG - Flint Igniter when Price Key is "**L**" or "**M**"

**Recommended Tools & Accessories:**

- CCBRSH1 - Card Cloth Brush
- MCBRS1 - Mold Cleaning Brush

Section 5  
UltraWeld® Exothermic Connections

**GO Connection Type**

Ground Rod Size	Cable Size	Mold Part No.	Weld Metal	
			UltraShot	NUWTUBE
1/2"	#6	GO-126L	US32	NUWTUBE32
	#4	GO-124L	US32	NUWTUBE32
	#2 Sol	GO-122SB	US90	NUWTUBE90
	#2	GO-122B	US90	NUWTUBE90
	1/0	GO-121/0B	US90	NUWTUBE90
	2/0	GO-122/0B	US90	NUWTUBE90
	3/0	GO-123/0B	US115	NUWTUBE115
	4/0	GO-124/0B	US115	NUWTUBE115
250 MCM	GO-1225CMB	US150	NUWTUBE150	
300 MCM	GO-123CMB	US200	NUWTUBE200	
5/8"	#6	GO-586L	US32	NUWTUBE32
	#4	GO-584L	US32	NUWTUBE32
	#2 Sol	GO-582SB	US90	NUWTUBE90
	#2	GO-582B	US90	NUWTUBE90
	1/0	GO-581/0B	US90	NUWTUBE90
	2/0	GO-582/0B	US115	NUWTUBE115
	3/0	GO-583/0B	US115	NUWTUBE115
	4/0	GO-584/0B	US115	NUWTUBE115
	250 MCM	GO-5825CMB	US150	NUWTUBE150
	300 MCM	GO-583CMB	US200	NUWTUBE200
350 MCM	GO-5835CMB	US200	NUWTUBE200	
500 MCM	GO-585CMB	US250	NUWTUBE250	

**GO Connection Type continued**

Ground Rod Size	Cable Size	Mold Part No.	Weld Metal	
			UltraShot	NUWTUBE
3/4"	#6	GO-346L	US45	NUWTUBE45
	#4	GO-344 <b>M</b>	US65	NUWTUBE65
	#2 Sol	GO-342SB	US90	NUWTUBE90
	#2	GO-342 <b>B</b>	US90	NUWTUBE90
	1/0	GO-341/0 <b>B</b>	US115	NUWTUBE115
	2/0	GO-342/0 <b>B</b>	US115	NUWTUBE115
	3/0	GO-343/0 <b>B</b>	US115	NUWTUBE115
	4/0	GO-344/0 <b>B</b>	US115	NUWTUBE115
	250 MCM	GO-3425CMB	US150	NUWTUBE150
	300 MCM	GO-343CMB	US200	NUWTUBE200
1"	350 MCM	GO-3435CMB	US200	NUWTUBE200
	500 MCM	GO-345CMB	US250	NUWTUBE250
	750 MCM	GO-3475CMC	US400	2-NUWTUBE200
	1/0	GO-101/0 <b>B</b>	US150	NUWTUBE150
	2/0	GO-102/0 <b>B</b>	US150	NUWTUBE150
	3/0	GO-103/0 <b>B</b>	US150	NUWTUBE150
	4/0	GO-104/0 <b>B</b>	US150	NUWTUBE150
	250 MCM	GO-1025CMB	US200	NUWTUBE200
	300 MCM	GO-103CMB	US200	NUWTUBE200
	350 MCM	GO-1035CMB	US200	NUWTUBE200
500 MCM	GO-105CMB	US250	NUWTUBE250	
750 MCM	GO-1075CMC	US400	2-NUWTUBE200	
1000 MCM	GO-101MMC	US500	2-NUWTUBE250	

**NOTES:**

- Molds listed are for copper-clad steel ground rods.
- For welding to full size copper-clad steel, stainless steel, galvanized steel or solid copper ground rods, add letter "F" to ground rod size. For sectional ground rods, add letter "S" to ground rod size. See chart on page 335 for details.